Compact single-phase type 2 (or 3) surge protector - Monobloc

DACN10-L21YG-275





- Cost effective single-phase surge protector
- Type 2+3 monobloc compact
- In/Imax: 5 kA/10 kA
- Max. load current: 16A
- Disconnection + AC line cut
- 2-port configuration (series mounting)
- Remote signaling
- EN 61643-11, IEC 61643-11 compliance

CE

Electrical Characteristics		
SPD type	IEC	2+3
Network		230/400V
AC system		TN
Max. AC operating voltage	Uc	275 Vac
Max. load current @25°C	IL	16 A
Temporary Over Voltage (TOV) Characteristics - 5 sec. *Without disconnection*	UT	335 Vac withstand
Temporary Over Voltage (TOV) Characteristics - 120 mn *Without disconnection or with safety disconnection*	UT	440 Vac disconnection
Residual Current *Leakage current to Ground*	Ipe	None
Nominal discharge current *15 x 8/20 µs impulses*	In	5 kA
Max. discharge current *max. withstand @ 8/20 µs by pole*	Imax	10 kA
Withstand on Combination waveform IEC 61643-11 *Class III test: 1.2/50µs - 8/20µs*	Uoc	10 kV
Protection level L/N *@ In (8/20µs)*	Up L/N	1.3 kV
Protection level N/PE *@ In (8/20µs)*	Up N/PE	1.6 kV
Protection level L/PE *@ In (8/20µs)*	Up L/PE	1.6 kV
Admissible short-circuit current	Isccr	10 000 A
Mechanical Characteristics		
SPD configuration		Single phase
Connection to Network		By screw terminals: 1.5-10mm²
Mounting		Symmetrical rail 35 mm (EN 60715)
Housing material		Thermoplastic UL94 V-0
Operating temperature	Tu	-40/+85°C
Protection rating		IP20
Failsafe mode		Disconnection and AC line cut-off
Disconnection indicator		Green LED OFF
Remote signaling of disconnection		option DACN10S-L21YG-275
Dimensions		See diagram - 1TE (EN43880)
Disconnectors		
Thermal disconnector		Internal
Installation ground fault breaker		Type 'S' or delayed
Back-up protection device		Fuses type gG - 25A
Standards		
Standards compliance		IEC 61643-11 / EN 61643-11 / UL1449 ed.5
Part number		
70115021		

DACN10-L21YG-275

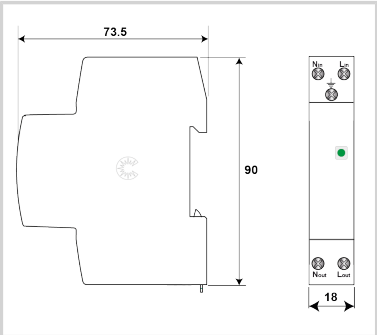

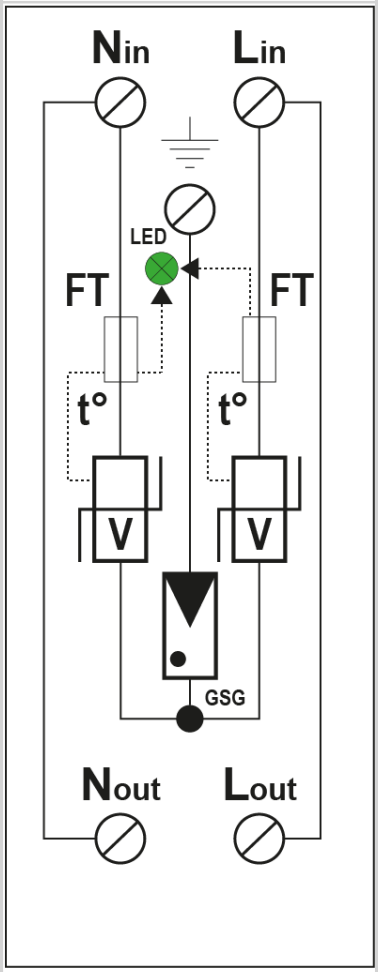

V: High-energy varistor
GSG: Specific Gas Tube
LED: Disconnection indicator
Ft: Thermal fuse
t°: Thermal disconnection system